



Release Notes

FortiADC 7.6.2



FORTINET DOCUMENT LIBRARY

<https://docs.fortinet.com>

FORTINET VIDEO LIBRARY

<https://video.fortinet.com>

FORTINET BLOG

<https://blog.fortinet.com>

CUSTOMER SERVICE & SUPPORT

<https://support.fortinet.com>

FORTINET TRAINING & CERTIFICATION PROGRAM

<https://www.fortinet.com/training-certification>

FORTINET TRAINING INSTITUTE

<https://training.fortinet.com>

FORTIGUARD LABS

<https://www.fortiguard.com>

END USER LICENSE AGREEMENT

<https://www.fortinet.com/doc/legal/EULA.pdf>

FEEDBACK

Email: techdoc@fortinet.com



April 25, 2025

FortiADC 7.6.2 Release Notes

TABLE OF CONTENTS

Change Log	4
Introduction	5
What's new	6
System	6
Network	6
Platform	6
Hardware, VM, cloud platform, and browser support	7
Resolved issues	9
Known issues	11
Image checksums	12
Upgrade notes	13
Supported upgrade paths	13
Data Partition Expansion 7.6.2	14
Upgrading a stand-alone appliance	16
Upgrading an HA cluster	17
Special notes and suggestions	18

Change Log

Date	Change Description
April 25, 2025	FortiADC 7.6.2 Release Notes initial release.

Introduction

This *Release Notes* covers the new features, enhancements, known issues, and resolved issues of FortiADC™ version 7.6.2, Build 0584.

To upgrade to FortiADC 7.6.2, see [Upgrade notes](#).

FortiADC provides load balancing, both locally and globally, and application delivery control. For more information, visit: <https://docs.fortinet.com/product/fortiadc>.

What's new

FortiADC 7.6.2 introduces enhancements and new features across various modules including Web Application Firewall, Server Load Balance, Global Load Balance, and more.

More detailed information is available in the [New Features Guide](#).

System

High Availability

Enhance Status Reporting Accuracy in Active-Passive HA

This enhancement improves status reporting accuracy in Active-Passive HA mode by ensuring that only the active device reflects current health information, providing a clearer and more accurate view of the system's operational state.

Network

Link Layer Discovery Protocol (LLDP) Support

FortiADC now supports the Link Layer Discovery Protocol (LLDP), a vendor-neutral Layer 2 protocol standardized by IEEE 802.1AB. LLDP is widely used in enterprise and data center networks for automated topology discovery, link validation, and inventory management. By exchanging device identity, interface capabilities, and system-level information with directly connected peers, LLDP enables accurate network visibility and simplifies the troubleshooting of physical connectivity issues.

Platform

Data Partition Expansion

In FortiADC 7.6.2, the data partition size is expanded to support larger firmware images and new feature implementations. The existing 400MB partition on most platforms has been a limiting factor for future enhancements. This update increases the partition size to the maximum allowable capacity based on the system's hardware, ensuring compatibility with upcoming releases.

For details, see [Data Partition Expansion 7.6.2 on page 14](#).

Support FortiFlex Token in User Data for Public Cloud BYOL

This enhancement enables FortiADC to parse and apply a FortiFlex license token provided through cloud-init user data during the initial deployment of BYOL instances on public cloud platforms—Azure, AWS, and GCP.

Hardware, VM, cloud platform, and browser support

This section lists the hardware models, hypervisor versions, cloud platforms, and web browsers supported by FortiADC 7.6.2. All supported platforms are 64-bit version of the system.

Supported Hardware:

- FortiADC 300D
- FortiADC 100F
- FortiADC 120F
- FortiADC 200F
- FortiADC 220F
- FortiADC 300F
- FortiADC 320F
- FortiADC 400F
- FortiADC 420F
- FortiADC 1000F
- FortiADC 1200F
- FortiADC 2000F
- FortiADC 2200F
- FortiADC 4000F
- FortiADC 4200F
- FortiADC 5000F

For more information on the supported hardware models, see FortiADC's [Hardware Documents](#).

Supported hypervisor versions:

VM environment	Tested Versions
VMware	ESXi 3.5, 4.x, 5.0, 5.1, 5.5, 6.0, 6.5, 6.7, 7.0, 8.0
Microsoft Hyper-V	Windows Server 2012 R2, 2016 and 2019
KVM	Linux version 3.19.0 qemu-img v2.0.0, qemu-img v2.2
Citrix Xen	XenServer 6.5.0
Xen Project Hypervisor	4.4.2, 4.5
OpenStack	Pike, Octavia 2023.2
Nutanix	AHV
Proxmox VE	6.4

Supported cloud platforms:

- AWS (Amazon Web Services)
- Microsoft Azure
- GCP (Google Cloud Platform)
- OCI (Oracle Cloud Infrastructure)
- Alibaba Cloud
- IBM Cloud

For more information on the supported cloud platforms, see the FortiADC [Private Cloud](#) and [Public Cloud](#) documents.

Supported web browsers:

- Mozilla Firefox version 109
- Google Chrome version 110

We strongly recommend you set either of the Web browsers as your default Web browser when working with FortiADC. You may also use other (versions of the) browsers, but you may encounter certain issues with FortiADC's Web GUI.

Resolved issues

The following issues have been resolved in FortiADC 7.6.2 release. For inquiries about particular bugs, please contact [Fortinet Customer Service & Support](#).

Bug ID	Description
1145394	Configured DNS settings are overridden by default nameserver in AWS.
1133903	FortiADC 300D fails to establish a connection with FortiAnalyzer, preventing log forwarding and analytics integration.
1131903	FortiADC returns <MISSING> in the SNMP response for sysinfo queries, resulting in incomplete system information retrieval.
1127248	Azure VM continuously reloads when the licensed instance size is smaller than the actual VM size, preventing stable operation.
1122454	Certificates are incorrectly deleted from the Local Certificate group when ACME encounters group members with missing or invalid IDs
1120679	Oracle health check stops working due to a memory leak caused by unfreed lists and buffers after <code>pthread_kill</code> , leading to resource exhaustion over time.
1120666	After upgrading from 7.4.x to 7.6.1, the GUI incorrectly displays the hardware license status as "Unknown support (Expires: Unknown)", despite valid licensing.
1120243	FortiADC 1200F reports incorrect traffic and packet counter values in SNMP and CLI due to improper interface name handling, leading to discrepancies in monitoring data.
1119257	HA fails to establish between FortiADC nodes on firmware version 7.4.7 B0378 due to heartbeat message decoding errors, preventing synchronization between FortiADC-1 and FortiADC-2 KVM nodes.
1118172	GeoIP database upgrade fails if the version exceeds 256, causing manual import failures and HA secondary sync issues due to improper version validation.
1116520	HTTP/2 requests to a specific URL result in timeouts, whereas HTTP/1.1 works without issue. This is due to delays in data transmission caused by HTTP/2 waiting for window updates. Internal adjustments to <code>httproxy</code> 's send-state flags were made to improve alignment with HTTP/2 flow control, reducing the likelihood of transmission stalls due to insufficient window size.
1116460	Memory issue due to unfreed LDAP structures before each check, leading to incremental memory usage increase and process termination.
1115210	Remote LDAP authentication fails when accessing via ConsolePort, as the <code>admin_auth</code> function is not triggered during login.

Bug ID	Description
1114401	Request to increase maximum request header value length limit.
1112914	FortiADC attempts to connect to 8.8.8.8 on port 53 when the DNS is configured to 0.0.0.0, despite the DNS setting being invalid.
1106109	Connected route not displaying in HA-VRRP due to insufficient rtmtd receiving buffer size configuration.
1103348	FortiADC AntiVirus does not block the EICAR file during upload (HTTP PUT), but can block it during download (HTTP GET) due to lack of support for scanning HTTP PUT traffic.
1100931	FortiADC L4 VS drops packets aggregated by the Generic Receive Offload (GRO) layer at ingress, causing packet loss.
1100897	The documentation needs to be updated to clarify that the "Clear" button is not available in the "All Sessions" section under FortiView.
1096464	FortiADC's SSH server public key length is insufficient. The recommended minimum RSA public key length is 2048 bits or greater.
1095322	SNMPv3 is not responding to the <code>usmStatsNotInTimeWindows</code> OID (.1.3.6.1.6.3.15.1.1.2.0), resulting in a failure to report the expected SNMP statistics.
1093020	REST-API allows token brute-force attacks and does not log failed login attempts, leading to potential security vulnerabilities.
1091639	Local certificate import fails when the passphrase for the private key contains a backslash (<code>\</code>), which is not handled properly.
1091469	Health check status is not properly updated on the secondary device after an HA failover. When the secondary device is promoted to primary, the status in the logical topology is not reflected correctly, leading to a lack of visibility on service availability and no alerts for service changes.

Common Vulnerabilities and Exposures

For more information, visit <https://www.fortiguard.com/psirt>.

Bug ID	Description
1129749	FortiADC 7.6.2 is no longer vulnerable to the following CVE-Reference: CVE-2025-26466.

Known issues


There are no known issues in version FortiADC7.6.2.

Image checksums

To verify the integrity of the firmware file, use a checksum tool and compute the firmware file's MD5 checksum. Compare it with the checksum indicated by Fortinet. If the checksums match, the file is intact.

MD5 checksums for Fortinet software and firmware releases are available from [Fortinet Customer Service & Support](#). After logging in to the web site, near the bottom of the page, click the Firmware Image Checksums button. (The button appears only if one or more of your devices has a current support contract.) In the File Name field, enter the firmware image file name including its extension, then click Get Checksum Code.

Customer Service & Support image checksum tool

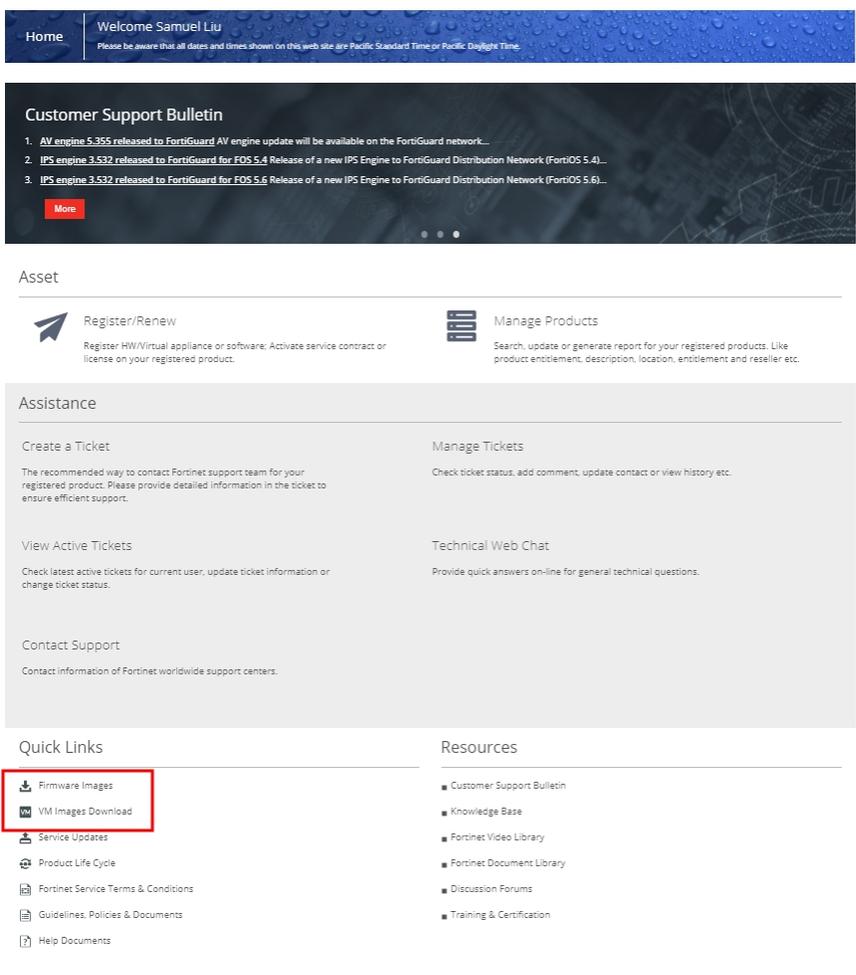

Upgrade notes

This section includes upgrade information about FortiADC 7.6.2.

Supported upgrade paths

This section discusses the general paths to upgrade FortiADC from previous releases.

If you are upgrading to a version that is in a higher version level, you will need to upgrade to the nearest branch of the major level incrementally until you reach the desired version. For example, to upgrade from 7.2.1 to 7.6.0, you will follow the upgrade path below:

7.2.1 → 7.2.x → 7.4.x → 7.6.0

(wherein "x" refers to the latest version of the branch)

7.4.x to 7.6.0/7.6.1/7.6.2

Direct upgrade via the web GUI or the Console.

7.2.x to 7.4.x

Direct upgrade via the web GUI or the Console.

7.1.x to 7.2.x

Direct upgrade via the web GUI or the Console.

7.0.x to 7.1.x

Direct upgrade via the web GUI or the Console.

6.2.x to 7.0.x

Direct upgrade via the web GUI or the Console.

6.1.x to 6.2.x

Direct upgrade via the web GUI or the Console.

6.0.x to 6.1.x

Direct upgrade via the web GUI or the Console.

5.4.x to 6.0.x

Direct upgrade via the web GUI or the Console.

5.3.x to 5.4.x

Direct upgrade via the web GUI or the Console.

5.2.x to 5.3.x

Direct upgrade via the web GUI or the Console.



For more information on upgrading from versions earlier than 5.2.x, please see the Upgrade Instructions document for that version.

Data Partition Expansion - 7.6.2

In FortiADC 7.6.2, the data partition size is expanded to support larger firmware images and new feature implementations. The existing 200MB partition on most platforms has been a limiting factor for future enhancements. This update increases the partition size to the maximum allowable capacity based on the system's hardware, ensuring compatibility with upcoming releases.

This expansion applies only to hardware appliances and private cloud instances. Public cloud images will maintain the current partition size.

Key Enhancements

Benefit	Details
Increased Storage Capacity	Expands the data partition from 200MB to the maximum available space on supported hardware and private cloud platforms, allowing more room for firmware images, logs, and feature enhancements.
Seamless Future Upgrades	Eliminates storage-related upgrade failures, ensuring smooth transitions to newer firmware versions.
Enhanced System Longevity	Prevents storage limitations from restricting feature adoption, extending the platform's scalability and maintainability.

Upgrade Considerations and Limitations

Expanding the data partition in FortiADC 7.6.2 introduces specific upgrade requirements and operational impacts. Administrators must follow a structured upgrade path to ensure a smooth transition while considering potential limitations.

Mandatory Upgrade Path

Upgrading beyond 7.6.2 (such as 7.6.3) requires installing 7.6.2 first. This ensures that the partition expansion is completed before applying a newer firmware version. Any attempt to upgrade directly to a post-7.6.2 release

without first installing 7.6.2 will be blocked.

Longer Upgrade Duration

Because the upgrade includes a partition resizing process, the total upgrade time is longer than a typical firmware update. The duration depends on the platform and storage configuration, so administrators should plan accordingly to minimize downtime.

Irreversible Partition Change

Once the partition is expanded in 7.6.2, it cannot be reverted by downgrading to a previous firmware version. The partition remains in its expanded state even if an earlier release is installed. Before upgrading, ensure that your environment is compatible with 7.6.2 and later versions.

HA Cluster Upgrade Best Practices

For HA (High Availability) clusters, follow these guidelines to prevent service disruption:

- Do not toggle HA mode during the upgrade, as this can lead to downtime for all nodes in the process.
- Upgrade each node individually, rather than upgrading all nodes at once, to minimize potential issues.
- For Active-Passive (A-P) clusters, start by upgrading the secondary node. Once the secondary node is fully operational, proceed to upgrade the primary node to ensure continued availability.

Verifying Successful Data Partition Expansion

After performing an upgrade to FortiADC version 7.6.2 or later, the data partition will be expanded to provide increased storage capacity. To verify that the expansion has been successfully applied, you can use the following CLI command:

```
diagnose hardware get sysinfo partition
```

This command returns detailed information on the system’s storage partitions, including the size of the data partition. By comparing the partition size values before and after the upgrade, you can confirm that the partition has been expanded as expected.

Example output comparison:

Platform	Before Upgrade to 7.6.2	After Upgrade to 7.6.2
Hardware (1200F)	<pre>FortiADC-1200F # diagnose hardware get sysinfo partition Disk /dev/sda: 240.0 GB, 240057409536 bytes 1 heads, 63 sectors/track, 7442256 cylinders Units = cylinders of 63 * 512 = 32256 bytes Device Boot Start End Blocks Id System /dev/sda1 * 2 7442256 234431032+ 83 Linux Partition 1 does not end on cylinder boundary Disk /dev/sdb: 2013 MB, 2013265920 bytes 1 heads, 62 sectors/track, 63421 cylinders Units = cylinders of 62 * 512 = 31744 bytes Device Boot Start End Blocks Id System /dev/sdb1 * 197 6649 200000 83 Linux Partition 1 does not end on cylinder boundary /dev/sdb2 6649 13100 200000 83 Linux Partition 2 does not end on cylinder boundary /dev/sdb3 13100 45358 1000000 83 Linux Partition 3 does not end on cylinder boundary</pre>	<pre>FortiADC-1200F # diagnose hardware get sysinfo partition Disk /dev/sda: 240.0 GB, 240057409536 bytes 1 heads, 63 sectors/track, 7442256 cylinders Units = cylinders of 63 * 512 = 32256 bytes Device Boot Start End Blocks Id System /dev/sda1 * 2 7442256 234431032+ 83 Linux Partition 1 does not end on cylinder boundary Disk /dev/sdb: 2013 MB, 2013265920 bytes 1 heads, 62 sectors/track, 63421 cylinders Units = cylinders of 62 * 512 = 31744 bytes Device Boot Start End Blocks Id System /dev/sdb1 * 197 13100 400000 83 Linux Partition 1 does not end on cylinder boundary /dev/sdb2 6649 13100 400000 83 Linux Partition 2 does not end on cylinder boundary /dev/sdb3 13100 58262 1000000 83 Linux Partition 3 does not end on cylinder boundary</pre>

Platform	Before Upgrade to 7.6.2	After Upgrade to 7.6.2
Virtual Machine	<pre>FortiADC-VM # diagnose hardware get sysinfo partition Disk /dev/sda: 2147 MB, 2147483648 bytes 1 heads, 63 sectors/track, 66576 cylinders Units = cylinders of 63 * 512 = 32256 bytes Device Boot Start End Blocks Id System /dev/sda1 * 194 6543 200000 83 Linux Partition 1 does not end on cylinder boundary /dev/sda2 6543 12892 200000 83 Linux Partition 2 does not end on cylinder boundary /dev/sda3 12892 25591 400000 83 Linux Partition 3 does not end on cylinder boundary Disk /dev/sdb: 32.2 GB, 32212254720 bytes 1 heads, 63 sectors/track, 998643 cylinders Units = cylinders of 63 * 512 = 32256 bytes Device Boot Start End Blocks Id System /dev/sdb1 * 2 998644 31457248+ 83 Linux Partition 1 does not end on cylinder boundary</pre>	<pre>FortiADC-VM # diagnose hardware get sysinfo partition Disk /dev/sda: 2147 MB, 2147483648 bytes 1 heads, 63 sectors/track, 66576 cylinders Units = cylinders of 63 * 512 = 32256 bytes Device Boot Start End Blocks Id System /dev/sda1 * 194 22416 700000 83 Linux Partition 1 does not end on cylinder boundary /dev/sda2 * 22416 44638 700000 83 Linux Partition 2 does not end on cylinder boundary /dev/sda3 44639 57337 400000 83 Linux Partition 3 does not end on cylinder boundary Disk /dev/sdb: 32.2 GB, 32212254720 bytes 1 heads, 63 sectors/track, 998643 cylinders Units = cylinders of 63 * 512 = 32256 bytes Device Boot Start End Blocks Id System /dev/sdb1 * 2 998644 31457248+ 83 Linux Partition 1 does not end on cylinder boundary</pre>

Upgrading a stand-alone appliance

The following figure shows the user interface for managing firmware (either upgrades or downgrades). Firmware can be loaded on two disk partitions: the active partition and the alternate partition. The upgrade procedure:

- Updates the firmware on the inactive partition and then makes it the active partition.
- Copies the firmware on the active partition, upgrades it, and installs it in place of the configuration on the inactive partition.

For example, if partition 1 is active, and you perform the upgrade procedure:

- Partition 2 is upgraded and becomes the active partition; partition 1 becomes the alternate partition.
- The configuration on partition 1 remains in place; it is copied, upgraded, and installed in place of the configuration on partition 2.

This is designed to preserve the working system state in the event the upgrade fails or is aborted.

Firmware			
Upgrade Firmware			
Partition	Active	Last Upgrade	Firmware Version
1	Enable	Thu Jul 7 05:15:02 2022	FA-VMX-7.00.01-FW-build0022
2	Disable	Mon Jun 6 14:12:21 2022	FA-VMX-6.01.04-FW-build0140

[Boot Alternate Firmware](#)

Before you begin:

- You must have super user permission (user admin) to upgrade firmware.
- Download the firmware file from the Fortinet Customer Service & Support website: <https://support.fortinet.com/>
- Back up your configuration before beginning this procedure. Reverting to an earlier firmware version could reset settings that are not compatible with the new firmware.
- You upgrade the alternate partition. Decide which partition you want to upgrade. If necessary, click **Boot Alternate Firmware** to change the active/alternate partitions.

To update the firmware:

1. Go to **System > Settings**.
2. Click the **Maintenance** tab.
3. Scroll to the **Firmware** section.
4. Click **Upgrade Firmware** to locate and select the firmware file.
5. Click  to upload the firmware and reboot.
The system replaces the firmware on the alternate partition and reboots. The alternate (upgraded) partition becomes the active, and the active becomes the alternate.
6. Clear the cache of your web browser and restart it to ensure that it reloads the web UI and correctly displays all interface changes.

Upgrading an HA cluster

The upgrade page includes an option to upgrade the firmware on all nodes in an HA cluster from the primary node.

The following chain of events occur when you use this option:

1. The primary node pushes the firmware image to the member nodes.
2. The primary node notifies the member nodes of the upgrade, and takes on their user traffic during the upgrade.
3. The upgrade command is run on the member nodes, the systems are rebooted, and the member nodes send the primary node an acknowledgment that the upgrade has been completed.
4. The upgrade command is run on the primary node, and it reboots. While the primary node is rebooting, a member node assumes the primary node status, and traffic fails over from the former primary node to the new primary node.

After the upgrade process is completed, the system determines whether the original node becomes the primary node, according to the HA Override settings:

- If Override is enabled, the cluster considers the Device Priority setting. Both nodes usually make a second failover in order to resume their original roles.
- If Override is disabled, the cluster considers the uptime first. The original primary node will have a smaller uptime due to the order of reboots during the firmware upgrade. Therefore, it will not resume its active role. Instead, the node with the greatest uptime will remain the new primary node. A second failover will not occur.

Before you begin, do the following:

1. Make sure that you have super user permission (user admin) on the appliance whose firmware you want to upgrade.
2. Download the firmware file from the Fortinet Customer Service & Support website:
<https://support.fortinet.com/>
3. Back up your configuration before beginning this procedure. Reverting to an earlier version of the firmware could reset the settings that are not compatible with the new firmware.
4. Verify that the cluster node members are powered on and available on all of the network interfaces that you have configured. (Note: If required ports are not available, HA port monitoring could inadvertently trigger an additional failover, resulting in traffic interruption during the firmware update.)

To update the firmware for an HA cluster:

1. Log into the web UI of the *primary* node as the `admin` administrator.
2. Go to **System > Settings**.
3. Click the **Maintenance** tab.
4. Scroll to the **Upgrade Firmware** button.
5. Click **Choose File** to locate and select the file.
6. Enable the **HA Cluster Upgrade**.
7. Click  to upload the firmware and start the upgrade process.

After the new firmware has been installed, the system reboots.



When you update software, you are also updating the web UI. To ensure the web UI displays the updated pages correctly:

- Clear your browser cache.
- Refresh the page.

In most environments, press Ctrl+F5 to force the browser to get a new copy of the content from the web application. See the Wikipedia article on browser caching issues for a summary of tips for many environments:

https://en.wikipedia.org/wiki/Wikipedia:Bypass_your_cache.

Special notes and suggestions

7.2.3

- The real server auto-populate feature is currently supported only in FortiADC version 7.2.3. Upgrading from version 7.2.3 to 7.4.0/7.4.1 will cause auto-populated real server related configuration loss, and may cause other unexpected behavior. Support for real server auto-population will be extended to later versions in the next release.

7.0.2/7.1.x

- After upgrading to 7.0.2/7.1.x, in Virtual Machine HA environments where both nodes have been installed with certificate embedded licenses you must reinstall those licenses. As some backend certificate files would have been synchronized and overwritten by the HA Peer (due to an existing bug), the certificate file would not be recoverable. Reinstalling the certificate embedded licenses is required to ensure they would work properly where they are needed, such as in ZTNA or FortiSandbox Cloud.

7.0.0

- When deploying the new GSLB based on FortiADC 7.0.0, the verify-CA function will be enabled by default.

6.2.2

- To use the SRIOV feature, users must deploy a new VM.

6.2.0

- In version 6.2.0, the default mode of QAT SSL has been changed to polling.

6.1.4

- Before downgrading from 6.1.4, ensure the new L7 TCP or L7 UDP application profiles are deleted or changed to a profile type that is supported in the downgrade version. Otherwise, this will cause the cmdb to crash.

5.2.0-5.2.4/5.3.0-5.3.1

- The backup configuration file in versions 5.2.0-5.2.4/5.3.0-5.3.1 containing the certificate configuration might not be restored properly (causing the configuration to be lost). After upgrading, please discard the old 5.2.x/5.3.x configuration file and back up the configuration file in the upgraded version again.



www.fortinet.com

Copyright© 2025 Fortinet, Inc. All rights reserved. Fortinet®, FortiGate®, FortiCare® and FortiGuard®, and certain other marks are registered trademarks of Fortinet, Inc., and other Fortinet names herein may also be registered and/or common law trademarks of Fortinet. All other product or company names may be trademarks of their respective owners. Performance and other metrics contained herein were attained in internal lab tests under ideal conditions, and actual performance and other results may vary. Network variables, different network environments and other conditions may affect performance results. Nothing herein represents any binding commitment by Fortinet, and Fortinet disclaims all warranties, whether express or implied, except to the extent Fortinet enters a binding written contract, signed by Fortinet's Chief Legal Officer, with a purchaser that expressly warrants that the identified product will perform according to certain expressly-identified performance metrics and, in such event, only the specific performance metrics expressly identified in such binding written contract shall be binding on Fortinet. For absolute clarity, any such warranty will be limited to performance in the same ideal conditions as in Fortinet's internal lab tests. Fortinet disclaims in full any covenants, representations, and guarantees pursuant hereto, whether express or implied. Fortinet reserves the right to change, modify, transfer, or otherwise revise this publication without notice, and the most current version of the publication shall be applicable.